

SERVICE INFORMATION

No. : SI-V44029-G
Date. : Jan. 5, 1990

(V) PIONEER


PIONEER															
MODEL NO.		*	SER. NO.		MODEL NO.		*	SER. NO.		MODEL NO.		*	SER. NO.		
CLD-3070/KU/CA		A	JL3919001-												
CLD-3070/SD/G		A	JL2914501-												
#	DETAIL OF CHANGE(S)							REASON FOR CHANGE(S)							
1	Deletion of a PCB hinge and addition of rubber cushions to the shield case for VSOP ASS'Y							X	To prevent VSOP ASS'Y from cracking						

[Problem]

VSOP Ass'y cracks at a certain point.

[Cause]

While the unit is being transported or handled, excessive stress is applied to VSOP ass'y at the position around a PCB hinge as indicated with (a).

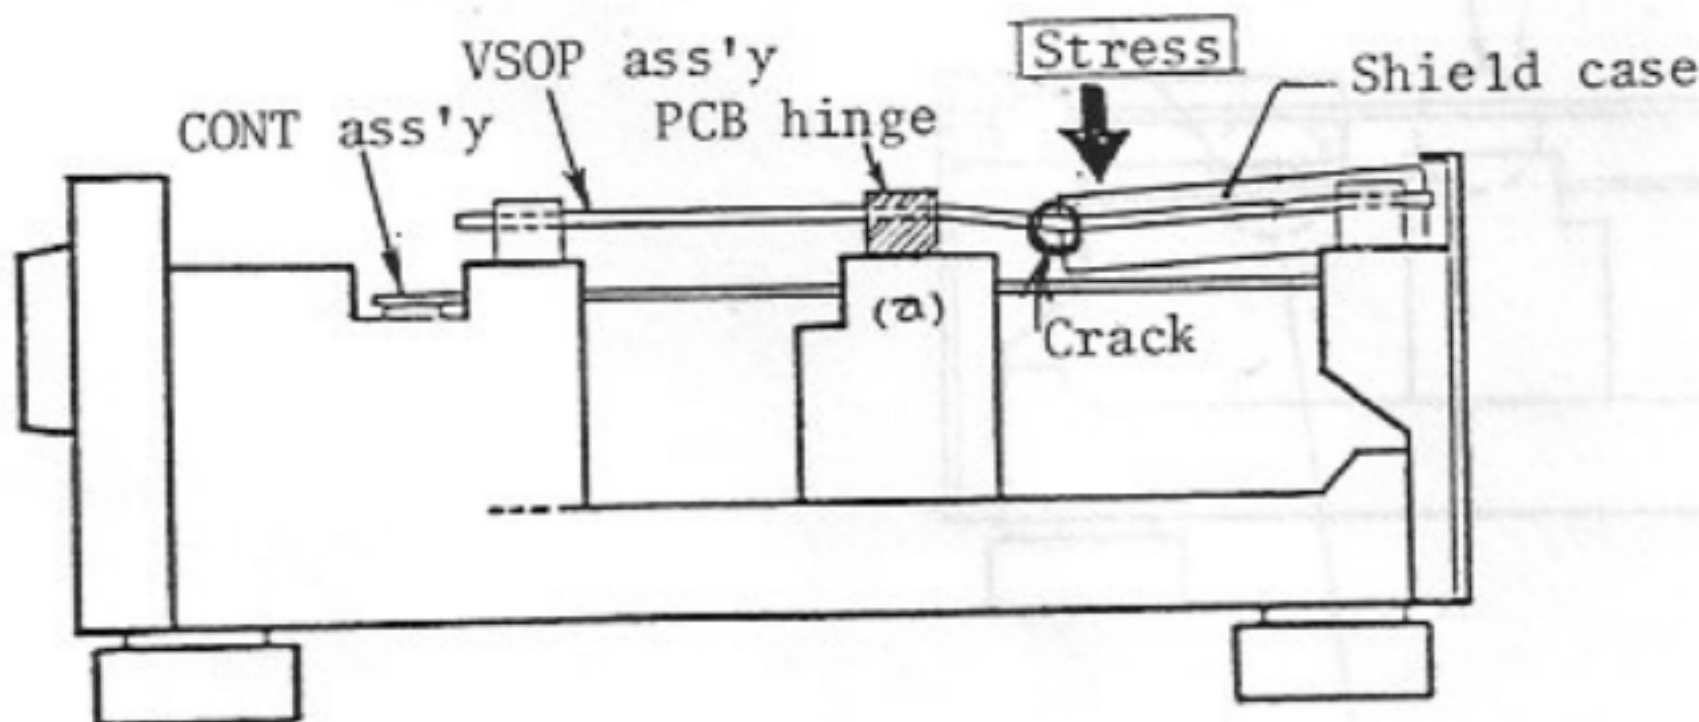

[FRONT]

- Please turn over. -

SERVICE MANUAL

MODEL: CLD-3070
S/M NO.: ARP1701
PAGE: 8

MODEL:
S/M NO.:
PAGE:

MODEL:
S/M NO.:
PAGE:

Ref.	CURRENT PARTS	NEW PARTS
* #	SYMBOL/DESCRIPTION PART NUMBER CODE	PART NUMBER SYMBOL/DESCRIPTION
A 1	Added	VEB1092 Rubber cushion

(FA9Y07 KK/MK 160)

PIONEER ELECTRONIC CORPORATION

[Counteraction in the production line/Service remedy]

- 1) Deleted a PCB hinge.
- 2) Added 2 rubber cushions (VEB1092) onto the shield case of VSOP Ass'y.

