

SERVICE INFORMATION

(1 / 1)




No. : SI-V47075-G

Date: Jan. 18, 1993


MODEL NO.	* SER. NO.	MODEL NO.	* SER. NO.	MODEL NO.	* SER. NO.
CLD-3090/KU/CA	A ---	CLD-2290/RD	A ---	CLD-2700/WB	A 7503201 -
CLD-2090/KU/CA	A ---	CLD-2600/WB	A ---	CLD-2700/WEZ	A MJ7407201 -
CLD-3390/RD	A ---	CLD-2600/WEZ	A ---		
# DETAIL OF CHANGE(S)			REASON FOR CHANGES		
1	Change of a lamp holder in FLKY ass'y		X	To prevent the lamp holder for the Disc side indication from being deformed due to heat	

<problem> Disc side won't be changed with the DISC SIDE buttons pushed.

<CAUSE> The lamp holder for Disc side indication gets deformed by heat when the ambient temperature is high. So, the Disc side button can't push the switch properly.

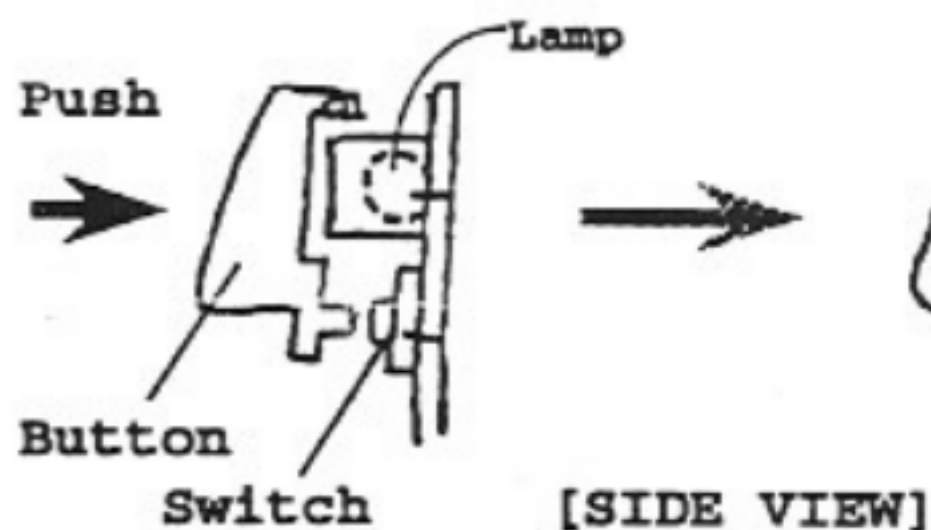

Deformed by heat.

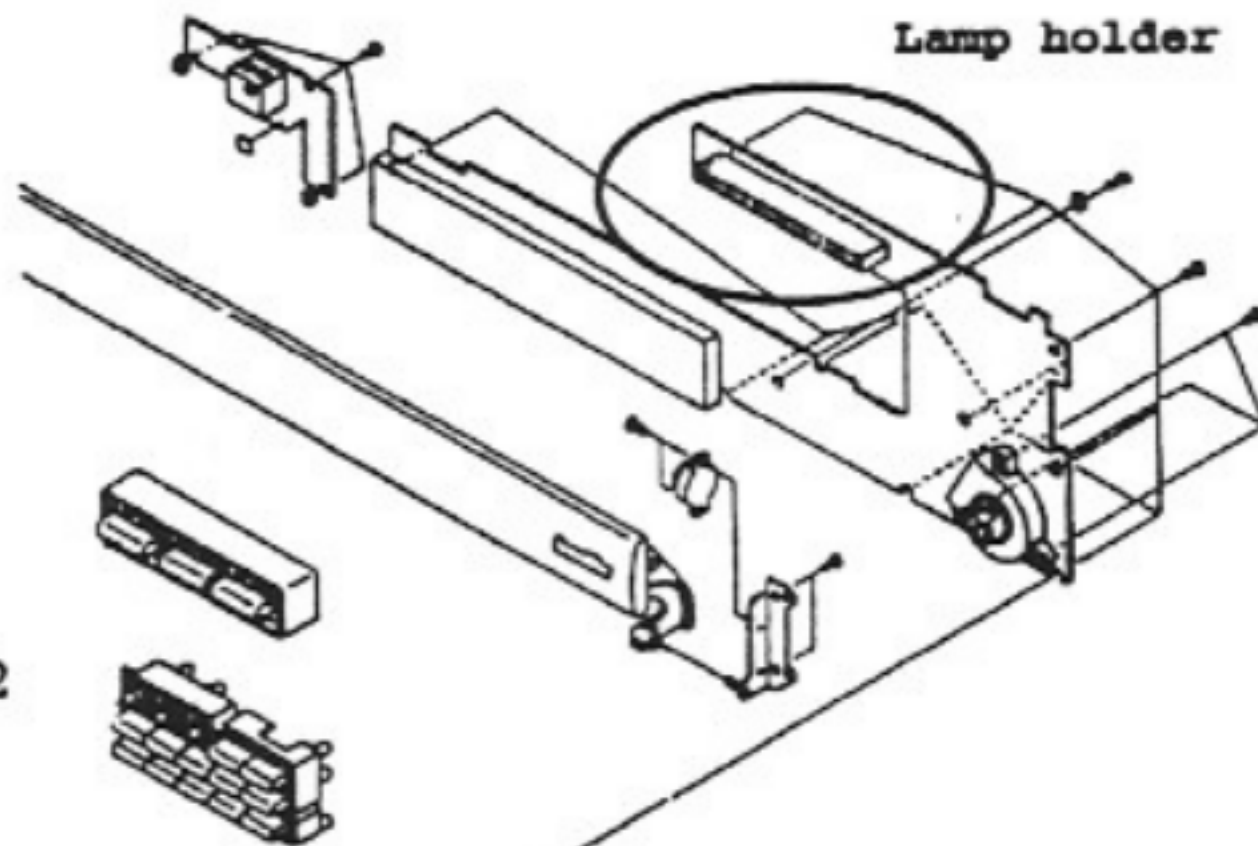

<COUNTERMEASURE IN FACTORY>

Changed the material for the lamp holder.

Lamp holder: N.S.P. ---> VNL1532

<SERVICE REMEDY>

When you encounter the above problem, please replace the lamp holder with the new part (VNL1532).

SERVICE MANUAL

MODEL : CLD-3090
S/M NO.: ARP2244
PAGE : 6

MODEL : CLD-2090
S/M NO.: ARP2241
PAGE : 6

MODEL : CLD-2600
S/M NO.: ARP2335
PAGE : 6

MODEL : CLD-2700
S/M NO.: ARP2526
PAGE : 6

Ref.	CURRENT PARTS			NEW PARTS	
* #	SYMBOL/DESCRIPTION	PART NUMBER	CODE	PART NUMBER	SYMBOL/DESCRIPTION
A 1	Lamp holder	N.S.P.	-	VNL1532	Lamp holder

PIONEER ELECTRONIC CORPORATION

(FA2X03, TB-13892 MK 120)

H.ABE, MANAGER

Technical Service Information & Coordination
Service Administration & Technical Information Dep.