

THOMSON TECHNICAL INFORMATION

RCA



PROSCAN

Product Support • Toll Stop 1-400
P.O. Box 1978 • Indianapolis, IN 46206-1978

Laser Disc Service Bulletin

LDP 94-001

File in Appropriate Section of Your Thomson Technical Bulletin Binder

DATE: July 15, 1994

Warranty Labor Rate: Intermediate

MODELS: LDR400, PSLD43

TOPIC: DISC TRAY JAMMING

Symptom: When attempting to load a disc, the disc tray may stick to the disc door.

Cause: The pin located at one end of the Spring Slanting Cam, item 13 in the Mechanism Chassis Section Exploded view or item J-013 in the parts list, may have deformed or broken off.

Cure: Replace the Spring Slanting Cam, stock number 209628. The replacement cam has an improved design to reduce the possibility of failure of the Spring Slanting Cam pin.


Product Safety Information

Product safety information is contained in the appropriate TCE Service Data covering models/chassis referenced in this bulletin. All specified Product Safety requirements and testing shall be complied with prior to returning equipment to the customer. Servicers who defeat safety features or fail to perform safety checks may be liable for any resulting damages and may expose themselves and others to possible injury.

First Edition — First Printing

Copyright 1994 — Thomson Consumer Electronics, Inc.

Printed in U.S.A. — Trademark(s) ® Registered — Marca(s) Registrada(s)

 **THOMSON CONSUMER ELECTRONICS**

TTI LDP 94-001